

Thor Motor Coach Recall Repair Instructions



Recall # 13V-265/ 2013-217 (Canada)

Description/Title: **RV Custom Product FW-2050 Battery Control Center**

Affected Product Line(s): **Certain Gas Class A Units**

Service Campaign # : **RC000077**

Released Date: **7/10/2013**

Failure Code: **TMCRC80432V**

Document Date: **7/10/2013**

Time Allowed: **0.25**

Document Revision: **A**

SUMMARY: On certain gas Class A units with the RV Custom Products FW-2050 Battery Control Center (BCC) there may be an issue with the chassis battery disconnect.

CONSEQUENCE: May cause loss of power to the chassis while driving causing the lights and/or other chassis components to cease functioning.

REMEDY: The chassis battery disconnect function will be bypassed. **This function will no longer work on the vehicle after the recall is performed.**

DIRECTIONS:


1. Locate the FW-2050 Battery Control Center. It should be under the hood, usually on the driver's side.
2. Disconnect the Chassis Battery and Cable at the Battery
3. Verify that the House Battery Disconnect is turned OFF.
4. Verify that the coach is NOT plugged in.
5. Verify that the generator is NOT running.



6. Remove the battery cable from the “Chassis Battery” post on the left hand side of the BCC.



7. Place the cable you just removed from the “Chassis Battery” post onto the post labeled “Chassis Switched”.

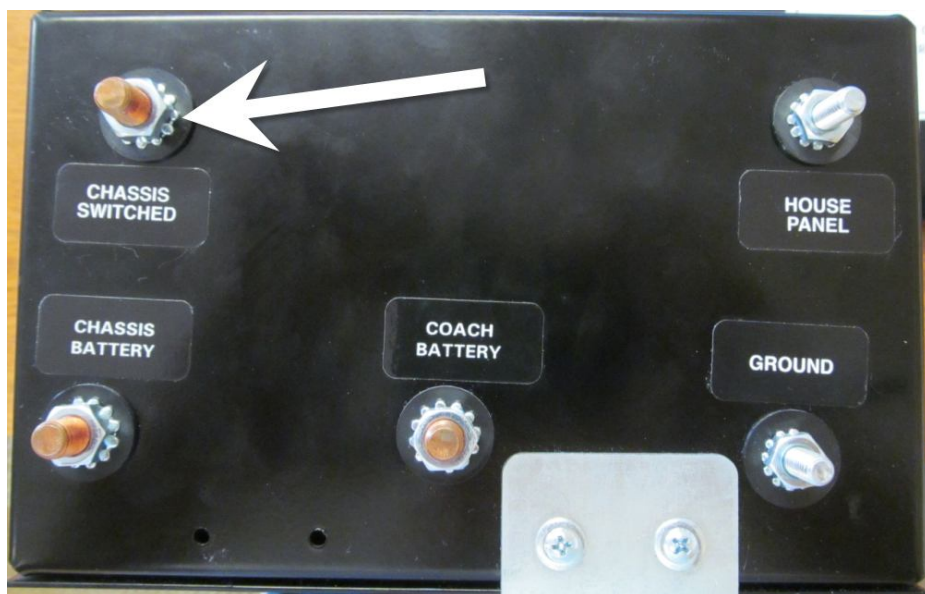

8. Tape off the “Chassis Battery” post.

9. Reconnect chassis battery and cable at the battery.