


LOOM HARNESS

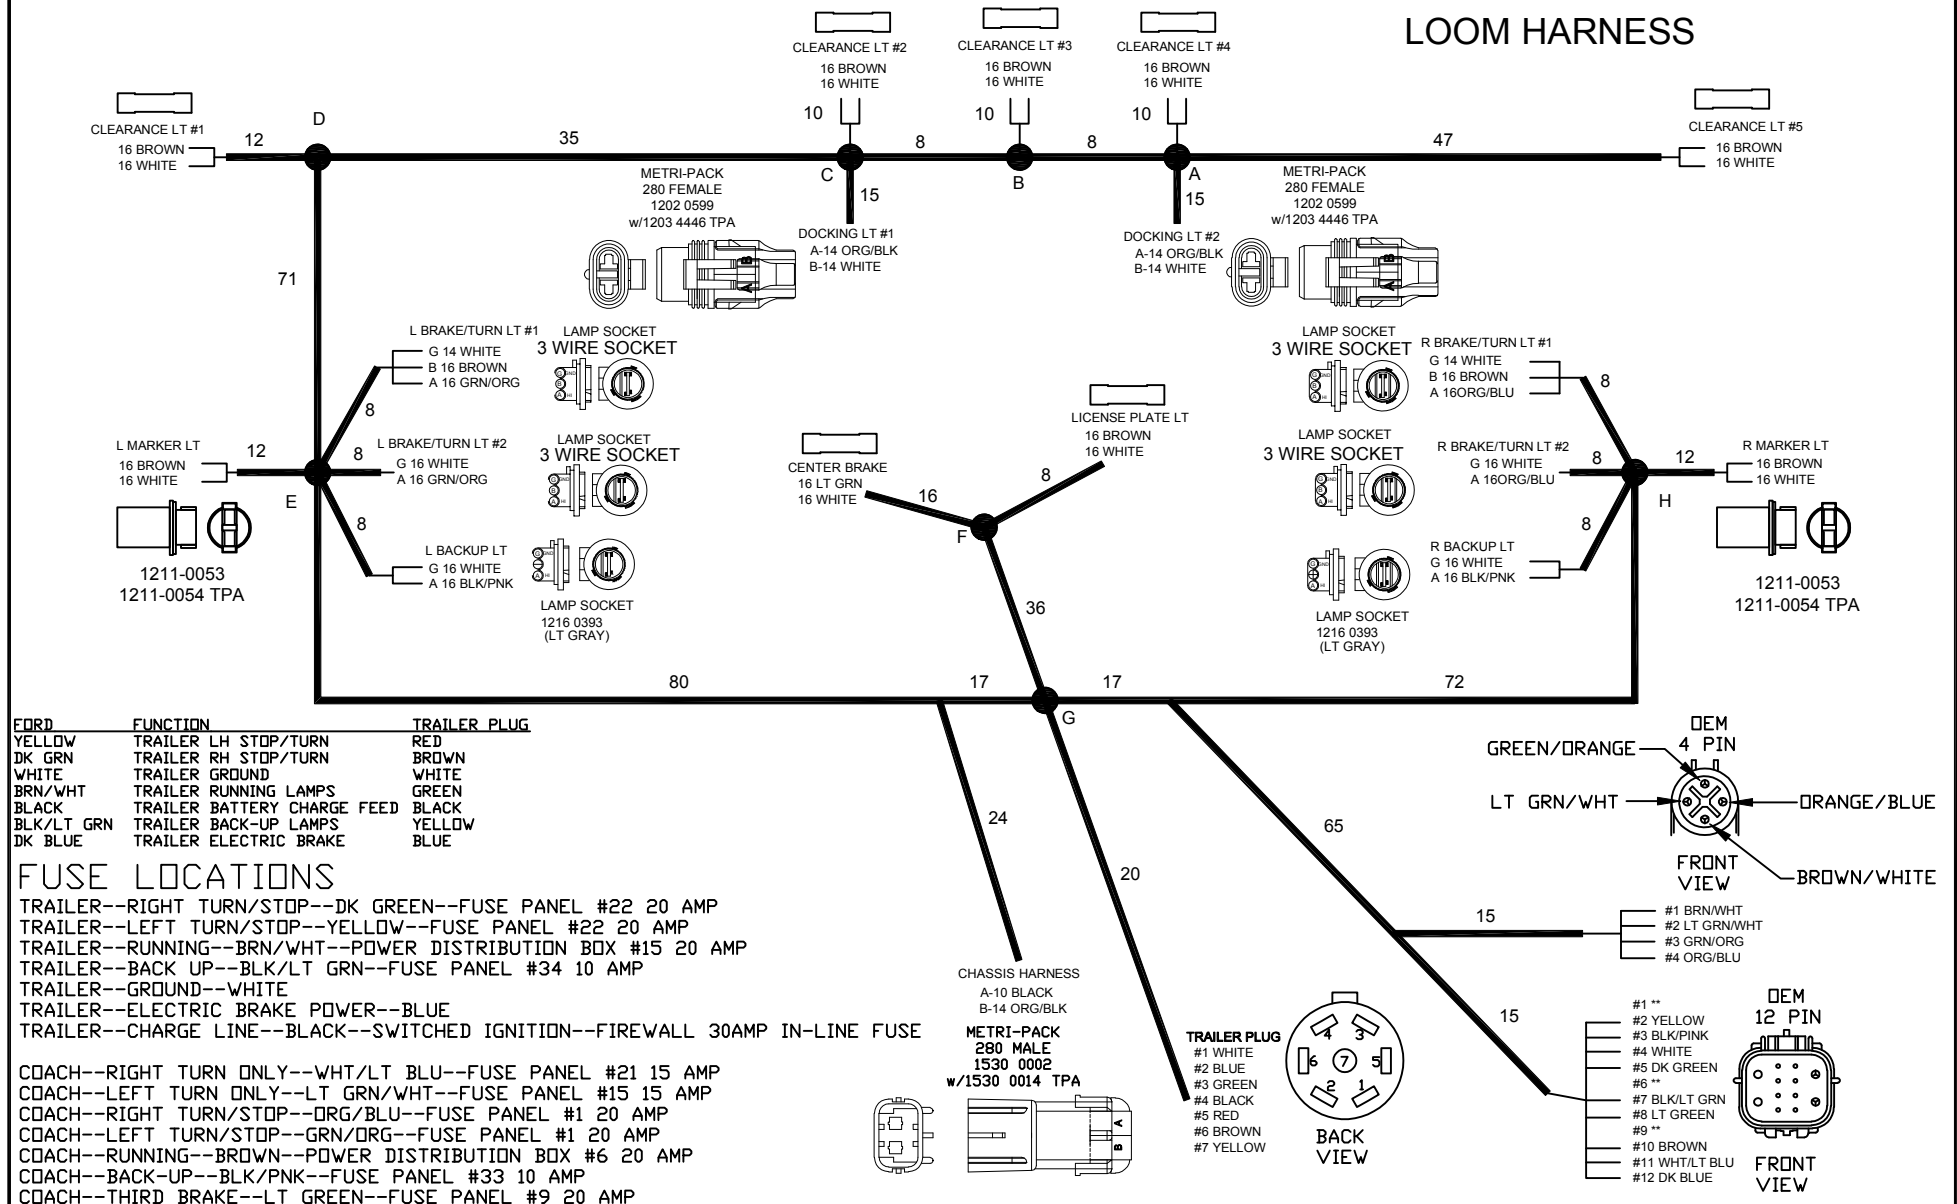

FORD	FUNCTION	TRAILER PLUG
YELLOW	TRAILER LH STOP/TURN	RED
DK GRN	TRAILER RH STOP/TURN	BROWN
WHITE	TRAILER GROUND	WHITE
BRN/WHT	TRAILER RUNNING LAMPS	GREEN
BLACK	TRAILER BATTERY CHARGE FEED	BLACK
BLK/LT GRN	TRAILER BACK-UP LAMPS	YELLOW
DK BLUE	TRAILER ELECTRIC BRAKE	BLUE

FUSE LOCATIONS

TRAILER--RIGHT TURN/STOP--DK GREEN--FUSE PANEL #22 20 AMP
 TRAILER--LEFT TURN/STOP--YELLOW--FUSE PANEL #22 20 AMP
 TRAILER--RUNNING--BRN/WHT--POWER DISTRIBUTION BOX #15 20 AMP
 TRAILER--BACK UP--BLK/LT GRN--FUSE PANEL #34 10 AMP
 TRAILER--GROUND--WHITE
 TRAILER--ELECTRIC BRAKE POWER--BLUE
 TRAILER--CHARGE LINE--BLACK--SWITCHED IGNITION--FIREWALL 30AMP IN-LINE FUSE

COACH--RIGHT TURN ONLY--WHT/LT BLU--FUSE PANEL #21 15 AMP
 COACH--LEFT TURN ONLY--LT GRN/WHT--FUSE PANEL #15 15 AMP
 COACH--RIGHT TURN/STOP--ORG/BLU--FUSE PANEL #1 20 AMP
 COACH--LEFT TURN/STOP--GRN/ORG--FUSE PANEL #1 20 AMP
 COACH--RUNNING--BROWN--POWER DISTRIBUTION BOX #6 20 AMP
 COACH--BACK-UP--BLK/PNK--FUSE PANEL #33 10 AMP
 COACH--THIRD BRAKE--LT GREEN--FUSE PANEL #9 20 AMP

REV	DESCRIPTION	DATE	BY	ECN
1	CHANGED THE LENGTH FROM 65 TO 71--LEFT LAMP SOCKETS TO CLEAR LGHTS	09/04/13	BWD	9364
2	CHANGE TO MATCH HOW HARNESS IS ACTUALLY BEING BUILT	9/13/13	MSH	10057
3	NOW USED FOR MIRAMAR AND CHALLENGER	11/12/13	BWD	10286
4	CHANGE SIDE MARKER LTS TO SIDE MARKER FUNCTION ONLY	4/1/14	ET	10625

ALL CONNECTORS SHOWN ARE LOAD VIEW UNLESS OTHERWISE NOTED.
 ALL WIRE MUST BE 125°C UNLESS OTHERWISE NOTED.
 LOOM AS NOTED BY _____
 LOOM SHOULD HAVE RATING OF 125°C MINIMUM.
 TOLERANCES:
 ± 1" ≤ 36"
 ± 2" > 36"
 REFERENCE TEE0556.XLS FOR CUTLIST

SPECIAL NOTES:

THOR MOTOR COACH			
DRAWN BY	ET	SHEET	1 OF 1
DATE	3/15/13		
DESCRIPTION	HARNESS, TAIL LIGHT		
MODEL	CHALLENGER, MIRAMAR		
CONFIDENTIAL AND PROPRIETARY INFORMATION OF THOR MOTOR COACH. ANY REPRODUCTION IN PART OR AS A WHOLE WITHOUT OUR EXPRESSED WRITTEN CONSENT IS PROHIBITED.	DRAWING NUMBER	tee0556	REVISION
			4